

Mid ONLY

Ship 12-12-12

Work Order ID 92687

November-07-12 2:33:10 PM

\*92687\*

Page 1

Item ID: D3391-023

Accept

\*N900040100\*

Setup Start

\*NS1\*

Revision ID:

Stop

\*NS2\*

Item Name: Mid Tube Assembly

Start Date: 11/07/12

Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 11/23/12

Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Approvals:

Process Plan: MLJ

Date: 12-11-08

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start

\*NR1\*

Stop

\*NR2\*

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

Draw Nbr

Revision Nbr

D3391

1

100

0.00

\*100\*

Skidtubes

Skidtubes

Memo

0.00

Skidtubes

1-Cut tube to finish length as per Dwg D3391

2-Drill pilot holes using DT8796 (Do not drill "B" holes) and drill only 1 fwd saddle hole on one side only as per Dwg D3391

3-Open saddles and GHW holes to Ø0.375" except for fwd saddle hole of detail "J"

4-Remove .030" from Fwd indexing Ridge as per Dwg D3391

5-Remove indexing ridge on Fwd & Aft end of skidtube as per Dwg D3391

6-Deburr

7-Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.250" holes with paint marker,  
\*\*\*DO NOT DRILL HOLES #3-19-20 FROM FWD END OF JIG

8-Open wearplate holes of D3391-023 assembly detail section G-G to Ø0.250" (10 holes) as per Dwg D3391

9-Open wearplate holes of D3391-023 assembly detail section H-H to Ø0.297" (20 holes) as per Dwg D3391  
\*\*\*DO NOT OPEN 2 MOST FWD WEARPLATE HOLES

12-12-6

392687

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

Work Order ID 92687

\*92687\*

Page 2

November-07-12 2:33:10 PM

Item ID: D3391-023

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Mid Tube Assembly

Start Date: 11/07/12 Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 11/23/12 Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start \*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
	10-Open .375" holes to .438" ***do not open fwd saddle holes***								
	11-Locate D3391-021 in D3391-023 at 9.00" (see view z-z)	- N/A							
	12- Transfer drill one fwd saddle hole only to .188" dia, transfer drill all remaining fwd saddle holes using DT 8149 locating from previously drill .188" dia hole, using t-pins and clicos to ensure perfect allingment, open up previously tranfer drilled pilot holes in D3391-023/-021 to 0.438" dia. in D3391-021	- N/A							
	13- Using DT8217, locating from two previously drilled holes, drill remaining wearplate holes into D3391-021.	- N/A							
	14- Locating from two fwd wearplate holes in D3391-023 drill remaining 6 wearplte holes in D3391-021 using DT8937	- N/A							
	15- Open 12 wearplate holes in D3391-021 to 0.297" dia.	- N/A							
	16- insert D3391-021 into D3391-23	- N/A							
	17- insert T-pins into first and third fwd saddle holes	- N/A							
	18- ON FIRST SIDE ONLY drill out 2nd and forth fwd saddles holes to 0.500" as per								
	19- ON 2ND SIDE ONLY ream out 2nd and forth saddle hole to 0.499".								
	20-Deburr and blow out all chips from inside tube, scribe batch # in D3391-023 at aft end.								

12-12-6

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

Landing Gear	General
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged
<input type="checkbox"/> Crushed/Crimped.	<input type="checkbox"/> Burrs
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio
	<input type="checkbox"/> Grain
	<input type="checkbox"/> Hardware
	<input type="checkbox"/> Inspection Incomplete
	<input type="checkbox"/> Instructions Incomplete/Unclear
	<input type="checkbox"/> Maintenance
	<input type="checkbox"/> Mislabelled
	<input type="checkbox"/> Misread
	<input type="checkbox"/> Offset
	<input type="checkbox"/> Out of Calibration
	<input type="checkbox"/> Out of Sequence
	<input type="checkbox"/> Outside Dimensions
	<input type="checkbox"/> Ovalized
	<input type="checkbox"/> Over/Under tolerance
	<input type="checkbox"/> Part Incorrect
	<input type="checkbox"/> Part Lost/Missing
	<input type="checkbox"/> Part Moved
	<input type="checkbox"/> Positioned Wrong
	<input type="checkbox"/> Power Loss/Surge
	<input type="checkbox"/> Pressure/Forced
	<input type="checkbox"/> Temperature/Cure
	<input type="checkbox"/> Weld
	<input type="checkbox"/> Wrong Stock Pulled
	<input type="checkbox"/> Other

# Work Order ID 92687

November-07-12 2:33:10 PM

**\*92687\***

Page 3

Item ID: D3391-023

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Mid Tube Assembly

Start Date: 11/07/12 Start Qty: 1.00 **\*1\***

Cust Item ID:

Required Date: 11/23/12 Req'd Qty: 1.00 **\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
110	QC5- Inspect part completeness to step on W/O	0.00							
<b>*110*</b>									
QC	Memo	0.00							
Quality Control									
120	Chemical Conversion Coat per QSI005 4.1	0.00							
<b>*120*</b>									
HandFinish	Memo	0.00							
Hand Finishing									
130	QC7-Inspect Chemical Conversion Coat	0.00							
<b>*130*</b>									
QC	Memo	0.00							
Quality Control									

DAS  
16  
9-89

12/12/06

1 26 12-12-06

DAS  
03  
9-89

12-12-06

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY				
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

# Work Order ID 92687

\*92687\*

Page 4

November-07-12 2:33:10 PM

Item ID: D3391-023 Accept \*N900040100\* Setup Start \*NS1\*  
 Revision ID: Stop \*NS2\*  
 Item Name: Mid Tube Assembly  
 Start Date: 11/07/12 Start Qty: 1.00 \*1\* Cust Item ID:  
 Required Date: 11/23/12 Req'd Qty: 1.00 \*1\* Customer:  
 Reference:

Approvals: Process Plan: Date: Tooling: Date: Run Start \*NR1\*  
 QC: Date: SPC (Y/N): Date: Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140 *140* Skidtubes	Skidtubes	0.00							
Skidtubes	Memo 1-Open float bag holes as per dwg 2-C'sink float bag holes as per dwg 3- Prepare tube for welding 4-Bond web in place as per Dwg D3391 & QSI 015. Adhere for 12 hours) A/R Sikaflex exp: 123 353 batch#: 13-6-22 NOTE:ENSURE WEB IS INSERTED IN AFT END OF TUBE	0.00							
150 *150* QC	QC5- Inspect part completeness to step on W/O	0.00							
Quality Control	Memo	0.00							

DC 12/12/06

1 8 12-12-07

DAS  
18  
9-20

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other



# Work Order ID 92687

\*92687\*

Page 5

November-07-12 2:33:10 PM

Item ID: D3391-023

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Mid Tube Assembly

Start Date: 11/07/12 Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 11/23/12 Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start \*NR1\*

QC:

Date:

SPC (Y/N):

Date:

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160		0.00							
*160*	Skidtubes								
Skidtubes	Memo	0.00							
Skidtubes	1-Weld crossbolt spacer as per dwg D3391 & QSI 004 2-grind weld flush								
170	QC10- Inspect visual per QSI004- ground welds	0.00							
*170*									
QC	Memo	0.00							
Quality Control									
180	QC5- Inspect part completeness to step on W/O	0.00							
*180*									
QC	Memo	0.00							
Quality Control									

A/R M122357 BE 12/12/07

DP 12-12-7

DAS 16 12/12/07

DAS 15 12/12/07

DAS 16 12/12/07

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%; border: none;"> <tr> <td style="width: 33%;">Skid-tube <input type="checkbox"/></td> <td style="width: 33%;">Crosstube <input type="checkbox"/></td> <td style="width: 33%;">Water Jet <input type="checkbox"/></td> <td style="width: 33%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

Landing Gear	General	Other	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain	<input type="checkbox"/> Ovalized
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware	<input type="checkbox"/> Over/Under tolerance
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete	<input type="checkbox"/> Part Incorrect
<input type="checkbox"/> Crushed/Crimped.	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear	<input type="checkbox"/> Part Lost/Missing
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance	<input type="checkbox"/> Part Moved
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled	<input type="checkbox"/> Positioned Wrong
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread	<input type="checkbox"/> Power Loss/Surge
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset	<input type="checkbox"/> Pressure/Forced
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration	<input type="checkbox"/> Temperature/Cure
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Weld
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Wrong Stock Pulled
			<input type="checkbox"/> Other

# Work Order ID 92687

\*92687\*

Page 6

November-07-12 2:33:10 PM

Item ID: D3391-023

Accept

\*N900040100\*

Setup Start

\*NS1\*

Revision ID:

Stop

\*NS2\*

Item Name: Mid Tube Assembly

Start Date: 11/07/12 Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 11/23/12 Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start

\*NR1\*

Stop

\*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
185	Pressure Wash per QSI005 4.3	0.00							
<b>*185*</b>									
HandFinish	Memo	0.00							
Hand Finishing	AND REALODINE AS PER PAR09-043								
190	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum	0.00							
<b>*190*</b>									
Powdercoat	Memo	0.00							
Powder Coating	START TIME: 10:50								
	OVEN TEMPERATURE: 320°F								
	FINISH TIME: 11:20								
200	QC3- Inspect Part Finish	0.00							
<b>*200*</b>									
QC	Memo	0.00							
Quality Control									

m 123383

IX d M 12/12/10

IX d M 12/12/10

IX d M 12/12/10

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>						
<b>Root Cause</b>	<b>Date</b>	<b>Step</b>	<b>Qty</b>	<b>Description of work order update or Non-conformance</b>	<b>Initial Chief Eng</b>	<b>Action Description</b>	<b>Sign &amp; Date</b>	<b>Verification</b>	<b>QC Inspector</b>			
Doc/Data <input type="checkbox"/>												
Equip/Tooling <input type="checkbox"/>												
Operator <input type="checkbox"/>												
Material <input type="checkbox"/>												
Setup <input type="checkbox"/>												
Other <input type="checkbox"/>												
Process <input type="checkbox"/>												
Supplier <input type="checkbox"/>												
Training <input type="checkbox"/>												
Unapproved <input type="checkbox"/>												
<b>FAULT CATEGORY</b>												
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other	

# Work Order ID 92687

\*92687\*

Page 7

November-07-12 2:33:10 PM

Item ID: D3391-023 Accept \*N900040100\* Setup Start \*NS1\*  
 Revision ID: Stop \*NS2\*  
 Item Name: Mid Tube Assembly  
 Start Date: 11/07/12 Start Qty: 1.00 \*1\* Cust Item ID:  
 Required Date: 11/23/12 Req'd Qty: 1.00 \*1\* Customer:  
 Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start \*NR1\*  
 QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230 *230* HandFinish Hand Finishing	HandFinishing Memo 1- press fit D3591-1 spacers using DT9416 starting from 0.500" side ✓ 2-Install Inserts as per Dwg	0.00 0.00				1x	1	14/12/10	PT027
240 *240* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00 0.00				1			
250 *250* Packaging Packaging	Identify as per dwg & Stock Location: _____ Memo	0.00 0.00				1		12/12/10	DAS 20-88

*N/A*  
*u 12/12/10*  
*mid only*

*DAS 15*  
*10 10 11*

*SH.0*

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY				
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other	

Install with: all millic (x1)

Quantity:

12 x

12 x

1 x

Part Number:

AV-36-41A (bolts)

NA-511-9C0332R (washer)

D-1095-045 (washer & Assembly)

Batch Number:

M123759

M123759

B 86241





**Work Order ID 92687****\*92687\***

Page 8

November-07-12 2:33:10 PM

Item ID: D3391-023

Accept

**\*N900040100\***

Setup Start

**\*NS1\***

Revision ID:

Stop

**\*NS2\***

Item Name: Mid Tube Assembly

Start Date: 11/07/12 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 11/23/12 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

**\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop

**\*NR2\***Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

260

QC21- Final Inspection - Work Order Release

0.00

**\*260\***

QC

Memo

0.00

Quality Control

12/12/11

mf

12-12-11

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	<b>Date</b>	<b>Step</b>	<b>Qty</b>	<b>Description of work order update or Non-conformance</b>	<b>Initial Chief Eng</b>	<b>Action Description</b>	<b>Sign &amp; Date</b>	<b>Verification</b>	<b>QC Inspector</b>		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY				
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other	

# Picklist Print

November-07-12 2:33:10 PM

Page 1

Work Order ID: 92687

Parent Item: D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 11/07/12

Required Date: 11/23/12

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP A05.10.20 New Issue KJ/EC  
IPP B06.02.10 ECN773 dwg rev.D EC  
IPP C 07.03.20 rev F dwg EC  
IPP D 07.03.28 re-format EC  
IPP E 07.10.31 ecn 1053P EC  
IPP Rev:F ECN 1056 07-11-13 DD verified by: EC  
IPP Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC  
IPP Rev:H 08-09-10 revH as per dwg DD verified by:EC  
IPP Rev: I 08-11-13 Removed steps per w/o, QC KJ verified by: ec IPP Rev:J add in seq 140  
expire date & b# sikaflex DD 10.02.17 verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2500-1-100 Skid tube Extrusion		Manufactured	No			100	Each	157.0000	1	1		12-12-06	
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				HALL		157							
				50251		3							
				82373		57							
				86065		97							
D3391-021 Fwd Tube Assembly		Manufactured	No			100	Each	0.0000	1	1		12-12-06	
		Manufactured	No			140	Each	7.0000	1	1		12/12/06	
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				LG		7							
				85508		4							
				86687		3							

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											
<b>FAULT CATEGORY</b>											
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other		

# Picklist Print

November-07-12 2:33:10 PM

Page 2

Work Order ID: 92687  
 Parent Item: D3391-023  
 Parent Item Name: Mid Tube Assembly

Start Date: 11/07/12

Required Date: 11/23/12

Start Qty: 1.00

Required Qty: 1.00



Manufactured No 160 Each 18.0000 5 5

*2E1212-07*  
*B92727 x5*

Location	Loc Qty	Loc Code
LG	8	
80361	1	
87611	7	
LG001	10	
68958	2	
69893	2	
71845	2	
74874	1	
76004	1	
77501	2	

D3591-1 Bushing Manufactured No

Each 39.0000 2

Location	Loc Qty	Loc Code
FP	5	
80377	4	
82027	1	
ST059	34	
57350	1	
83237	33	

ALS4-1032-130 ☒ Insert  
*ALS4-1032-130 / M122763*

Purchased No 230 Each 389.0000 20 *sl* 20 *u1216*

Location	Loc Qty	Loc Code
ST280	205	
119084	116	
120671	89	
ST281	44	
120807	36	
120837	8	
ST282	140	
121269	140	

*x20*

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

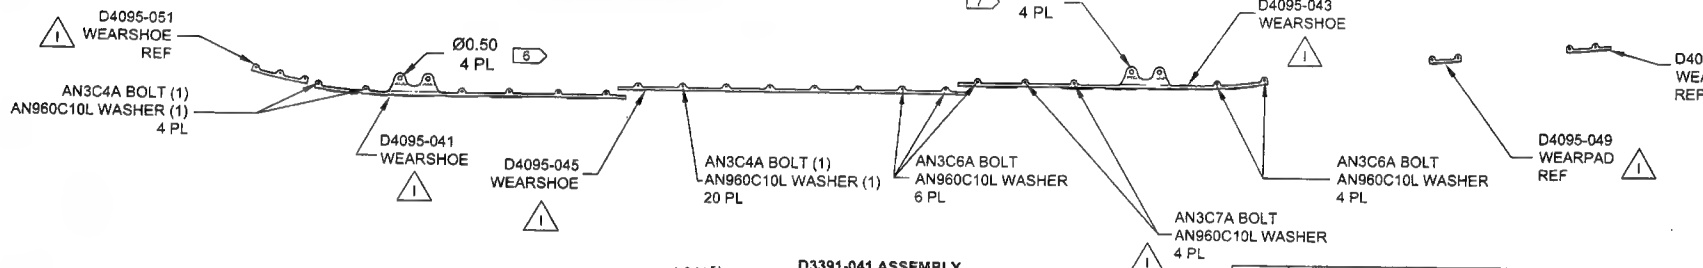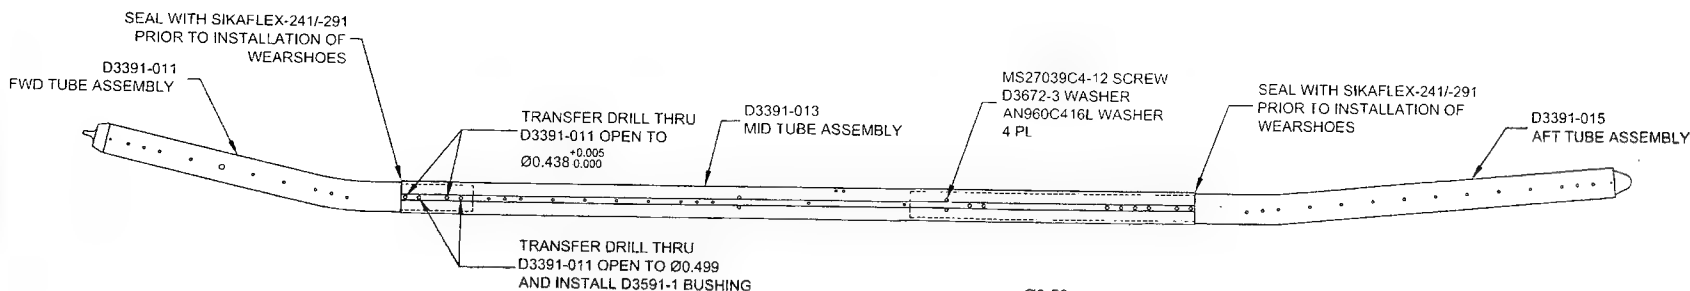

#### D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
2	D3591-1	BUSHING
4	D3672-3	WASHER
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARPAD
1	D4095-049	WEARPAD
1	D4095-051	WEARSHOE
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
38	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER


#### SHOP RELEASE ENGINEER UNCONTROLLED SUBJECT TO WORK ORDER NO. 92687 MLS 12-11-08

#### GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS.PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL  $\varnothing 0.297$  SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- 6) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL  $\varnothing 0.50$  HOLES FROM SADDLE TO D4095-041
- 7) FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL  $\varnothing 0.50$  HOLES FROM SADDLE TO D4095-043


RELEASED  
2011-11-04  
ECN#11-662

I	REMOVE GASKETS AND REPLACE ALL WEARSHOES; PARTS LIST UPDATE, ZN A8-1, ZN A8-2, ZN A6-4, ZN B6-8; LPS-3 COATING REMOVED FROM NOTE 2 ZN A3-1, ZN A3-2, REMOVED INSERT AELS-1032-130, ZN B6-4, B2-4, C7-8, C3-8; REMOVED HOLES, ZN D6-4 ZN D2-4, ZN D7-8, ZN D3-8	XDF	11.10.13
H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C6 $\varnothing 0.438$ DIM WAS 4 PL. ADDED $\varnothing 0.499$ DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C6 $\varnothing 0.438$ DIM WAS 4 PL. ADDED $\varnothing 0.499$ DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. I
MFG. APPR.		D3391	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

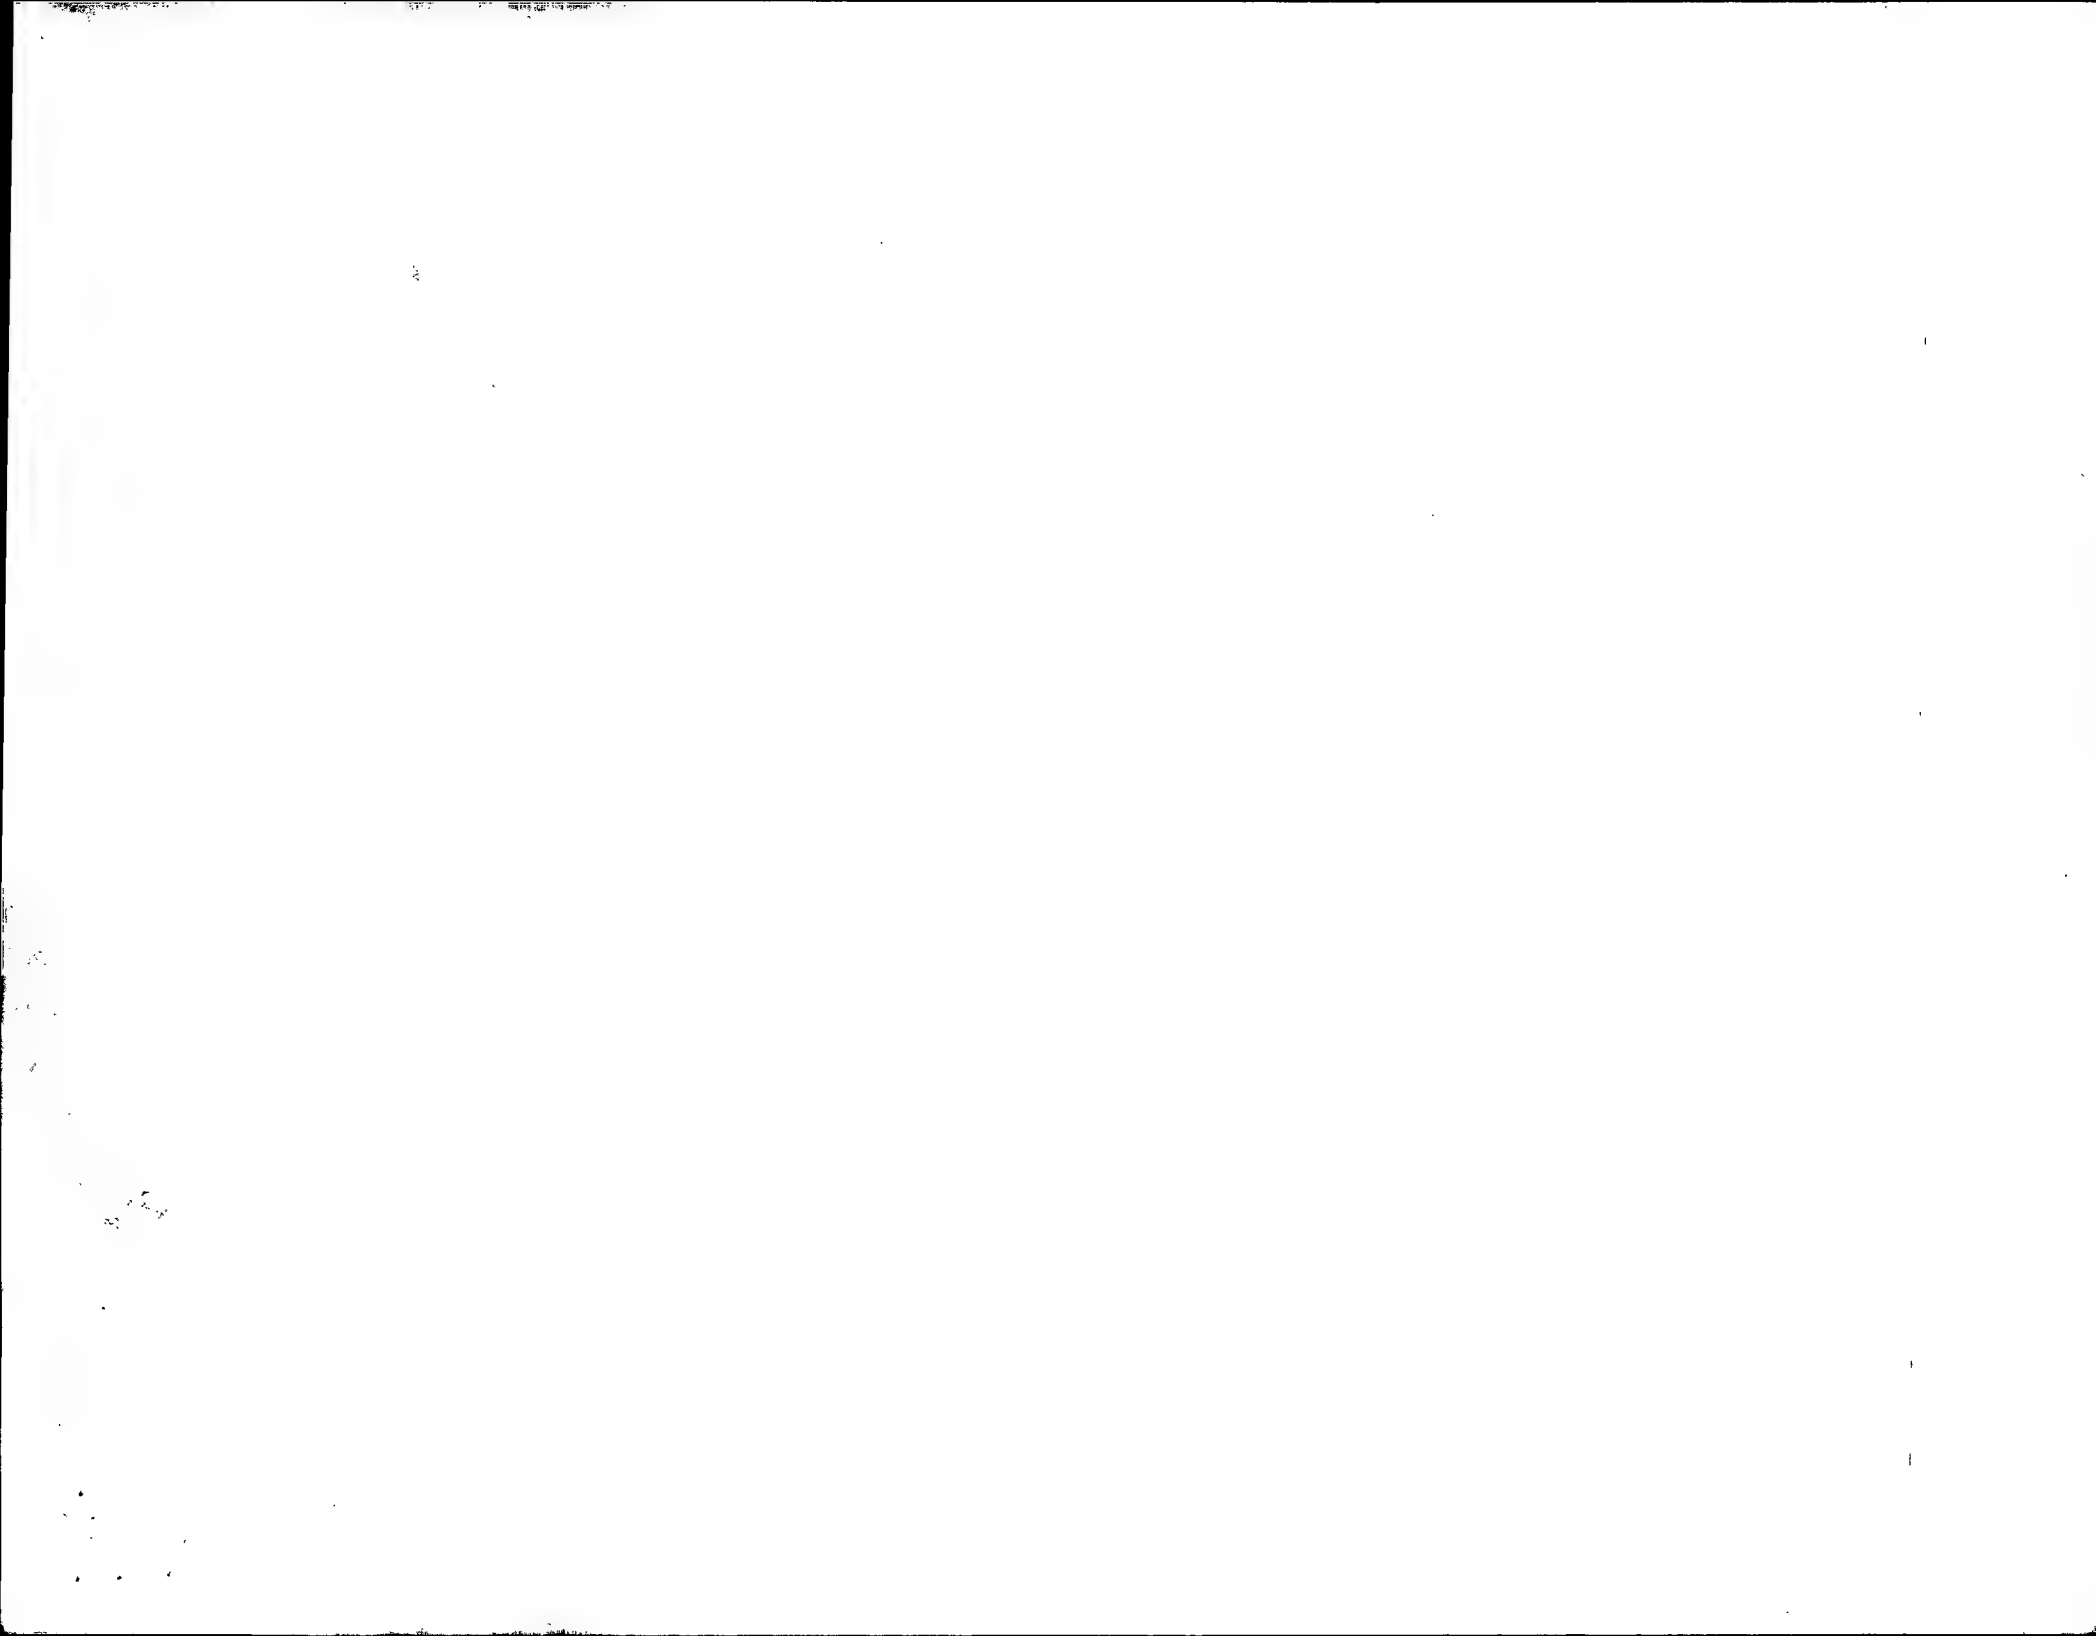



92687

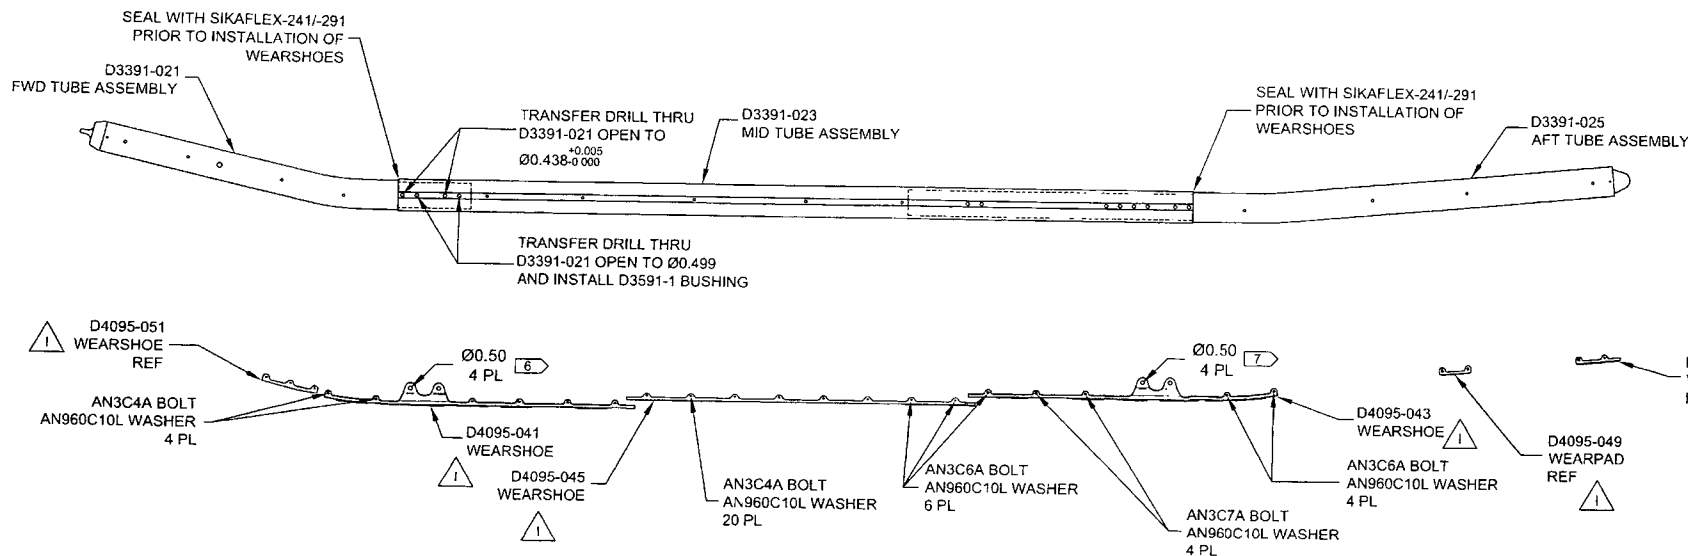

**D3391-043 ASSEMBLY**

**D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST**

QTY	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
2	D3591-1	BUSHING
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARSHOE
1	D4095-049	WEARPAD
1	D4095-051	WEARSHOE
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
38	AN960C10L	WASHER


**GENERAL NOTES**

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON"
- 3) AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 4) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 5) UNITS: INCHES UNLESS OTHERWISE NOTED
- 6) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- 7) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
- 8) FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043


RELEASED  
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	


92687

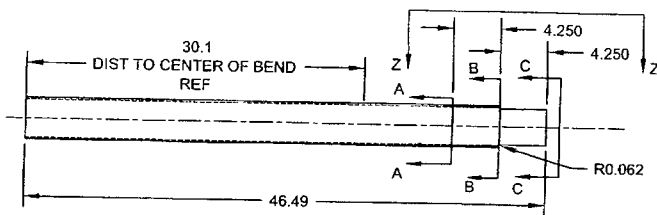


**D3391-1 CUTTING DETAIL**  
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

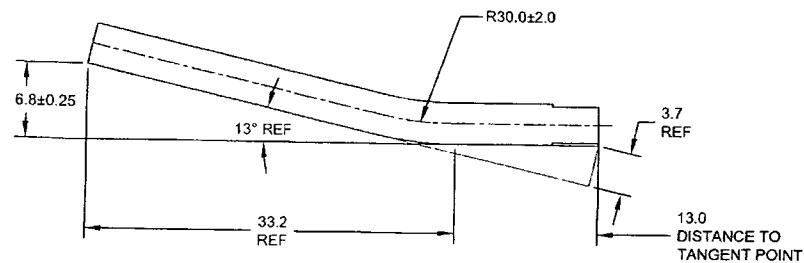


**D3391-011/-021 BENDING DETAIL**  
(MAKE FROM D3391-1)

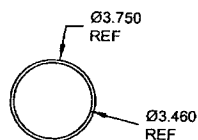


**SECTION A-A**  
SCALE 2X

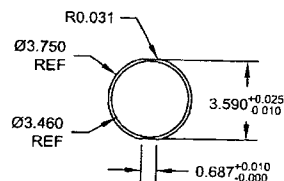

**SECTION B-B**  
SCALE 2X

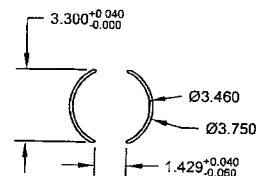

**SECTION C-C**  
SCALE 2X




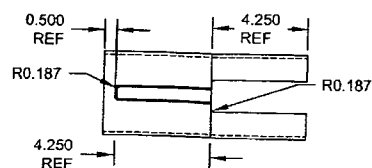


**VIEW Z-Z**  
SCALE 2X

RELEASED  
2011-11-04


DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	<small>COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

92687

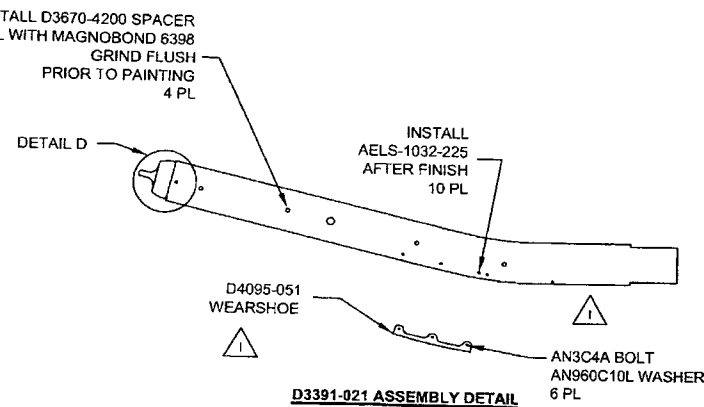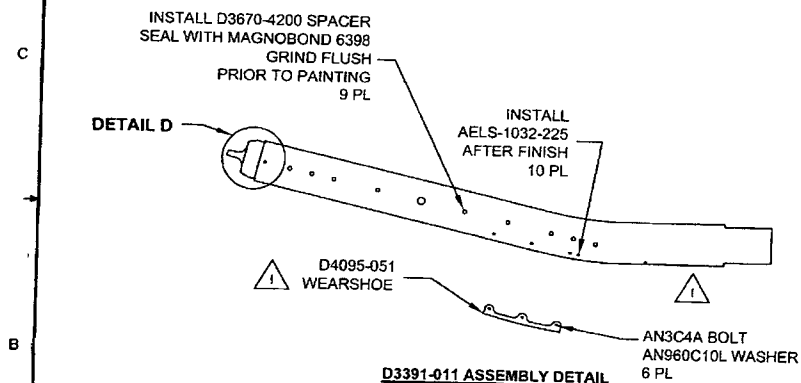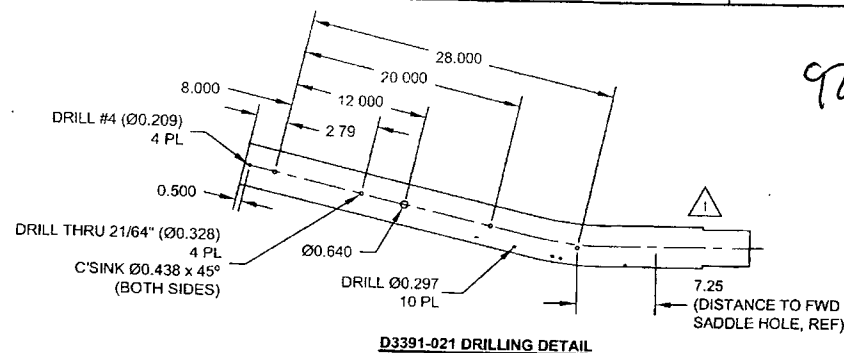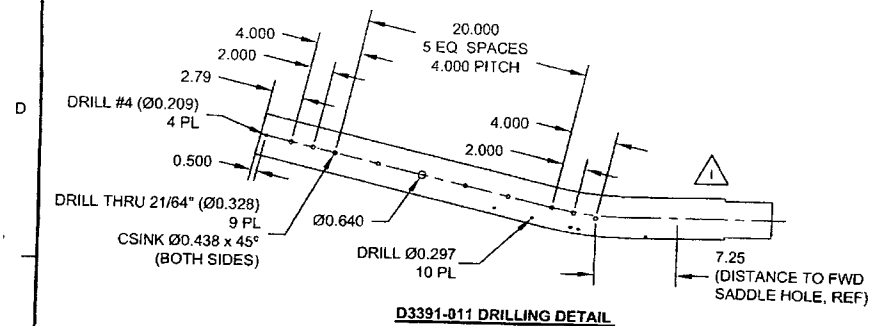

**D3391-011/-021 FWD TUBE ASSEMBLY PARTS LIST**


QTY - 011	QTY - 021	PART NUMBER	DESCRIPTION
X		D3391-011	FWD TUBE ASSEMBLY
	X	D3391-021	FWD TUBE ASSEMBLY
1	1	D3401-041	TOW CAP
9	4	D3670-4200	SPACER
4	4	D3672-1	WASHER
1	1	D4095-051	WEARSHOE
1	1	D6013-047	FWD TUBE
10	10	AN3C4A	BOLT
10	10	AN960C10L	WASHER
10	10	AELS-1032-225	INSERT

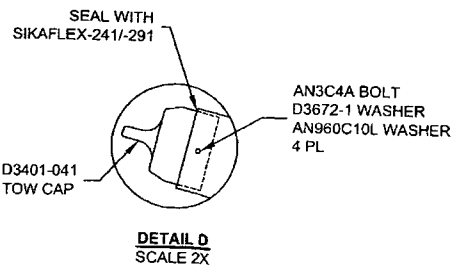


RELEASED  
2011-11-04

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 4 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	




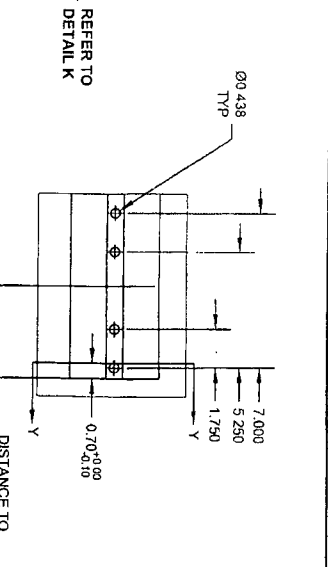

**DETAIL K**  
**SCALE 4X**

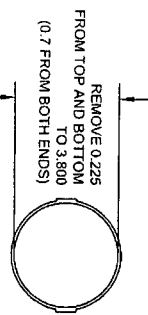

1  
2  
3  
4  
5  
6  
7  
8  
9  
10  
11  
12  
13  
14  
15  
16  
17  
18  
19  
20  
21  
22  
23  
24  
25  
26  
27  
28  
29  
30  
31  
32  
33  
34  
35  
36  
37  
38  
39  
40  
41  
42  
43  
44  
45  
46  
47  
48  
49  
50  
51  
52  
53  
54  
55  
56  
57  
58  
59  
60  
61  
62  
63  
64  
65  
66  
67  
68  
69  
70  
71  
72  
73  
74  
75  
76  
77  
78  
79  
80  
81  
82  
83  
84  
85  
86  
87  
88  
89  
90  
91  
92  
93  
94  
95  
96  
97  
98  
99  
100  
101  
102  
103  
104  
105  
106  
107  
108  
109  
110  
111  
112  
113  
114  
115  
116  
117  
118  
119  
120  
121  
122  
123  
124  
125  
126  
127  
128  
129  
130  
131  
132  
133  
134  
135  
136  
137  
138  
139  
140  
141  
142  
143  
144  
145  
146  
147  
148  
149  
150  
151  
152  
153  
154  
155  
156  
157  
158  
159  
160  
161  
162  
163  
164  
165  
166  
167  
168  
169  
170  
171  
172  
173  
174  
175  
176  
177  
178  
179  
180  
181  
182  
183  
184  
185  
186  
187  
188  
189  
190  
191  
192  
193  
194  
195  
196  
197  
198  
199  
200  
201  
202  
203  
204  
205  
206  
207  
208  
209  
210  
211  
212  
213  
214  
215  
216  
217  
218  
219  
220  
221  
222  
223  
224  
225  
226  
227  
228  
229  
230  
231  
232  
233  
234  
235  
236  
237  
238  
239  
240  
241  
242  
243  
244  
245  
246  
247  
248  
249  
250  
251  
252  
253  
254  
255  
256  
257  
258  
259  
260  
261  
262  
263  
264  
265  
266  
267  
268  
269  
270  
271  
272  
273  
274  
275  
276  
277  
278  
279  
280  
281  
282  
283  
284  
285  
286  
287  
288  
289  
290  
291  
292  
293  
294  
295  
296  
297  
298  
299  
300  
301  
302  
303  
304  
305  
306  
307  
308  
309  
310  
311  
312  
313  
314  
315  
316  
317  
318  
319  
320  
321  
322  
323  
324  
325  
326  
327  
328  
329  
330  
331  
332  
333  
334  
335  
336  
337  
338  
339  
340  
341  
342  
343  
344  
345  
346  
347  
348  
349  
350  
351  
352  
353  
354  
355  
356  
357  
358  
359  
360  
361  
362  
363  
364  
365  
366  
367  
368  
369  
370  
371  
372  
373  
374  
375  
376  
377  
378  
379  
380  
381  
382  
383  
384  
385  
386  
387  
388  
389  
390  
391  
392  
393  
394  
395  
396  
397  
398  
399  
400  
401  
402  
403  
404  
405  
406  
407  
408  
409  
410  
411  
412  
413  
414  
415  
416  
417  
418  
419  
420  
421  
422  
423  
424  
425  
426  
427  
428  
429  
430  
431  
432  
433  
434  
435  
436  
437  
438  
439  
440  
441  
442  
443  
444  
445  
446  
447  
448  
449  
450  
451  
452  
453  
454  
455  
456  
457  
458  
459  
460  
461  
462  
463  
464  
465  
466  
467  
468  
469  
470  
471  
472  
473  
474  
475  
476  
477  
478  
479  
480  
481  
482  
483  
484  
485  
486  
487  
488  
489  
490  
491  
492  
493  
494  
495  
496  
497  
498  
499  
500  
501  
502  
503  
504  
505  
506  
507  
508  
509  
510  
511  
512  
513  
514  
515  
516  
517  
518  
519  
520  
521  
522  
523  
524  
525  
526  
527  
528  
529  
530  
531  
532  
533  
534  
535  
536  
537  
538  
539  
540  
541  
542  
543  
544  
545  
546  
547  
548  
549  
550  
551  
552  
553  
554  
555  
556  
557  
558  
559  
560  
561  
562  
563  
564  
565  
566  
567  
568  
569  
570  
571  
572  
573  
574  
575  
576  
577  
578  
579  
580  
581  
582  
583  
584  
585  
586  
587  
588  
589  
590  
591  
592  
593  
594  
595  
596  
597  
598  
599  
600  
601  
602  
603  
604  
605  
606  
607  
608  
609  
610  
611  
612  
613  
614  
615  
616  
617  
618  
619  
620  
621  
622  
623  
624  
625  
626  
627  
628  
629  
630  
631  
632  
633  
634  
635  
636  
637  
638  
639  
640  
641  
642  
643  
644  
645  
646  
647  
648  
649  
650  
651  
652  
653  
654  
655  
656  
657  
658  
659  
660  
661  
662  
663  
664  
665  
666  
667  
668  
669  
670  
671  
672  
673  
674  
675  
676  
677  
678  
679  
680  
681  
682  
683  
684  
685  
686  
687  
688  
689  
690  
691  
692  
693  
694  
695  
696  
697  
698  
699  
700  
701  
702  
703  
704  
705  
706  
707  
708  
709  
710  
711  
712  
713  
714  
715  
716  
717  
718  
719  
720  
721  
722  
723  
724  
725  
726  
727  
728  
729  
730  
731  
732  
733  
734  
735  
736  
737  
738  
739  
740  
741  
742  
743  
744  
745  
746  
747  
748  
749  
750  
751  
752  
753  
754  
755  
756  
757  
758  
759  
760  
761  
762  
763  
764  
765  
766  
767  
768  
769  
770  
771  
772  
773  
774  
775  
776  
777  
778  
779  
780  
781  
782  
783  
784  
785  
786  
787  
788  
789  
790  
791  
792  
793  
794  
795  
796  
797  
798  
799  
800  
801  
802  
803  
804  
805  
806  
807  
808  
809  
810  
811  
812  
813  
814  
815  
816  
817  
818  
819  
820  
821  
822  
823  
824  
825  
826  
827  
828  
829  
830  
831  
832  
833  
834  
835  
836  
837  
838  
839  
840  
84

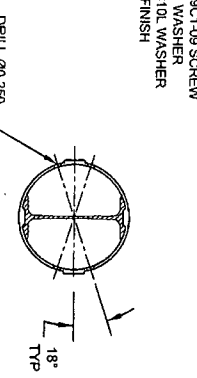

**SECTION LL-LL**  
**SCALE 5X**

DESIGN	PH	DRAWING NO.		REV. 1
DRAWN	XOP	D33391		SHEET 5 OF 8
CHECKED	S	TITLE		SCALE
MFG. APPR		412 FLOAT SKIDTUBE		NONE
APPROVED	<i>[Signature]</i>	DART AEROSPACE USA, INC. KENT, WA 412 FLOAT SKIDTUBE, INC. 14800 10TH AVE. S.W. SUITE 100 BURTON, WA 98012 TEL: (206) 835-1100 FAX: (206) 835-1101 E-MAIL: <a href="mailto:SALES@DARTAEROSPACE.COM">SALES@DARTAEROSPACE.COM</a>		
DE APPR		DATE 11.10.13		

RELEASED  
2011-11-04

**412 FLOAT SKIDTUBE**



COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS UNCLASSIFIED AND CONTAINS NO INFORMATION THAT IS EXCLUDED FROM THE COMBINATION MATRIS (NATO) SECRET PROGRAM.


NTS




92687

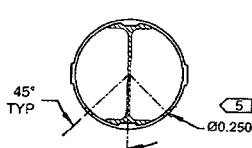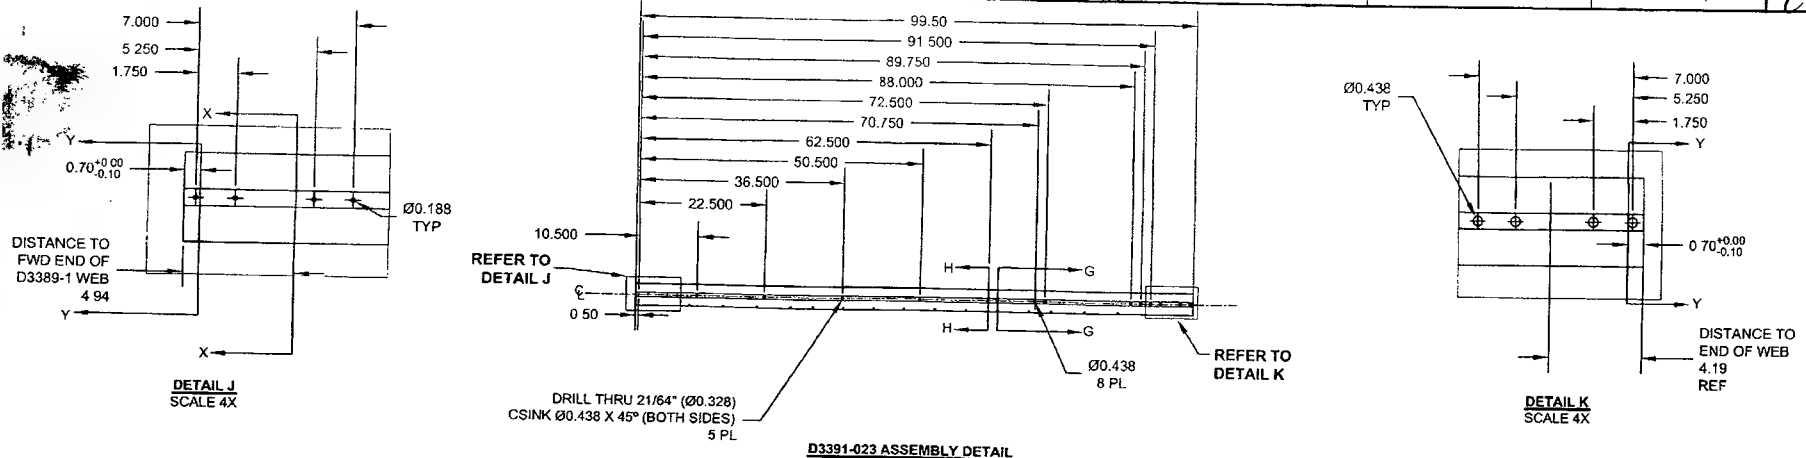


SECTION G-G  
SCALE 5X

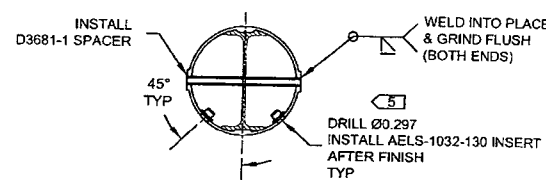

SECTION H-H  
SCALE 5X

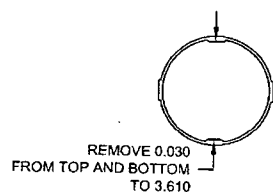

SECTION X-X  
SCALE 5X

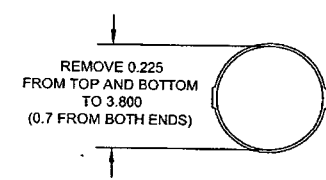

SECTION Y-Y  
SCALE 5X

**D3391-023 MID TUBE ASSEMBLY PARTS LIST**

QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT

**D3391-023 MID TUBE ASSEMBLY**

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
- 3) WELDING: PER DART QSI 004


RELEASED  
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 6 OF 8
APPROVED		TITLE	SCALE
DE APPR		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	






92607

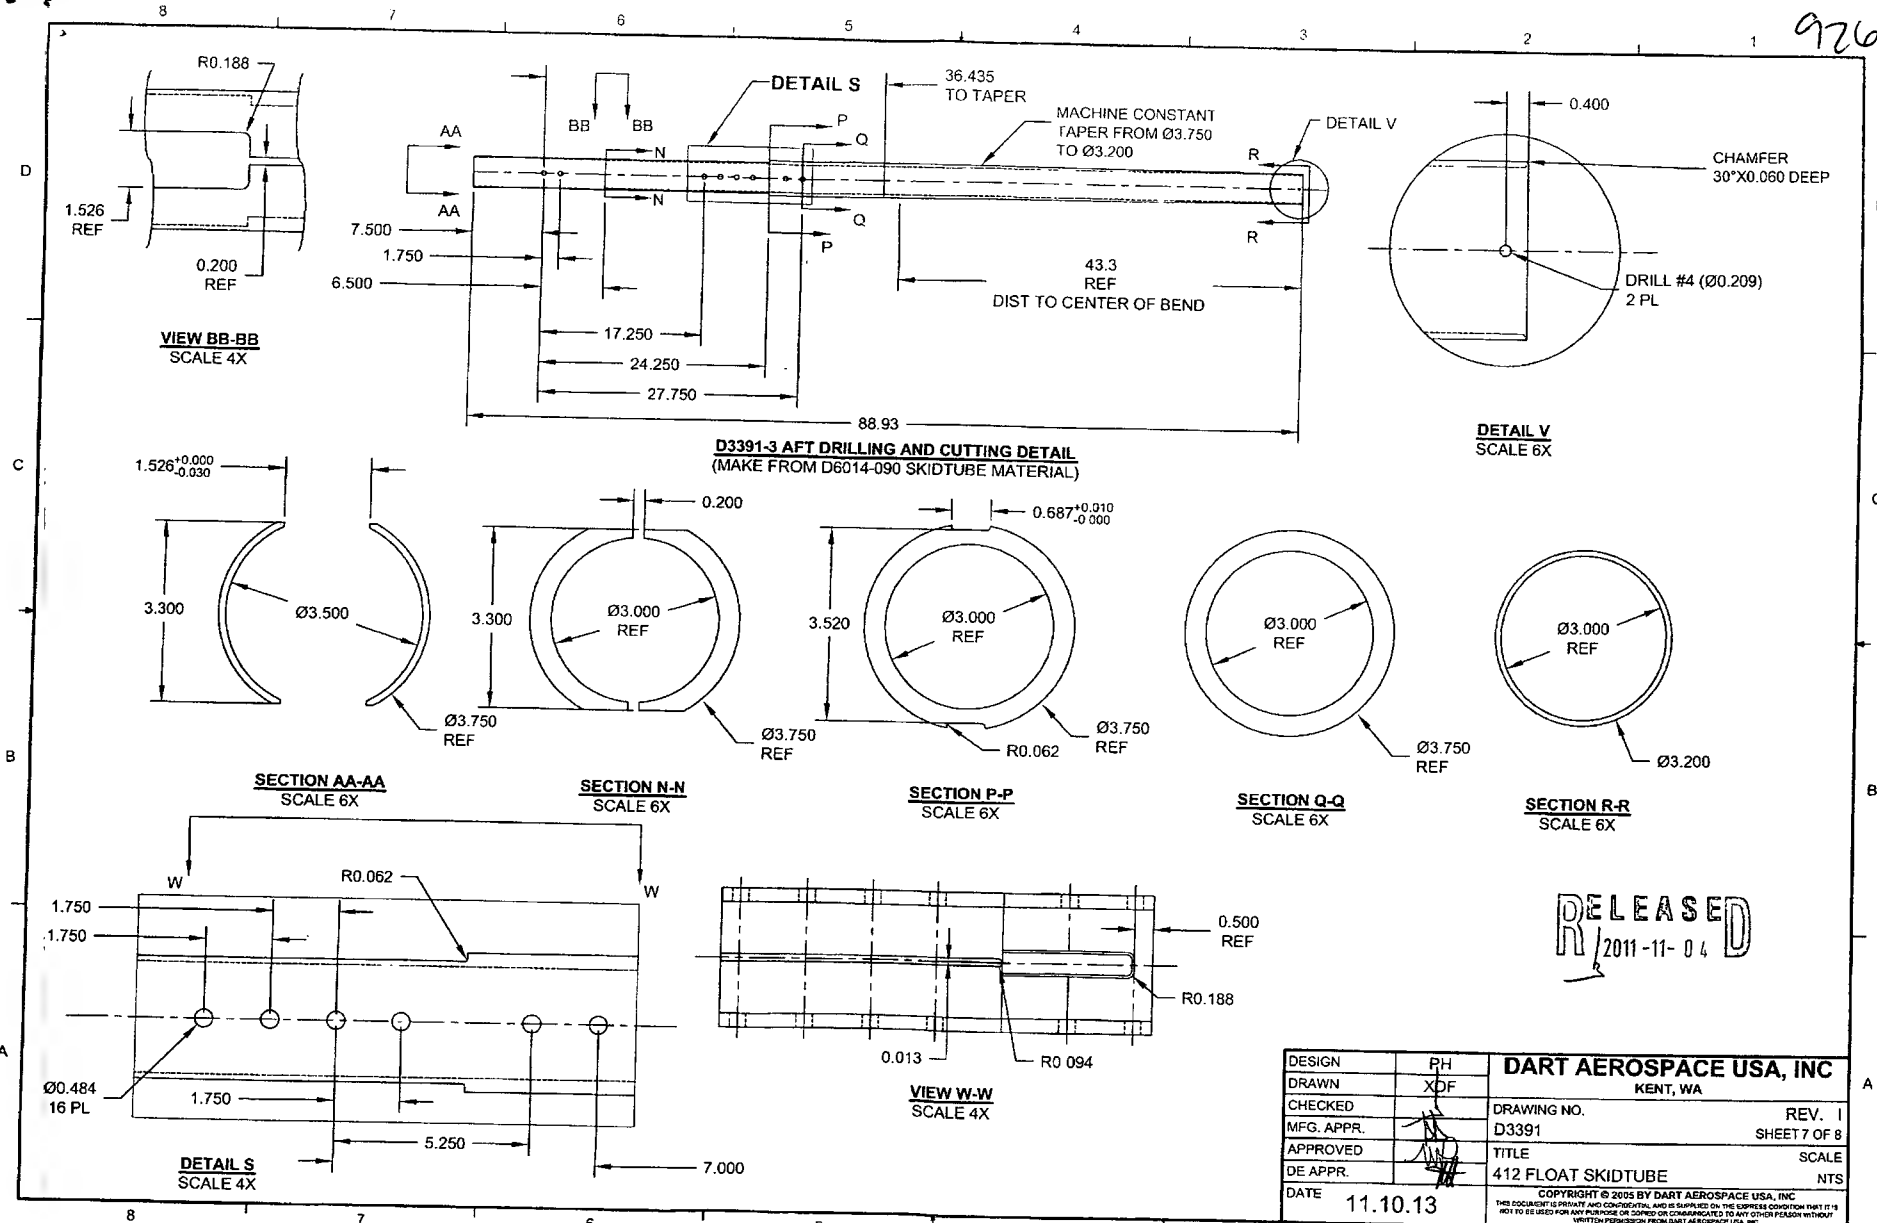

DESIGN	RH	<b>DART AEROSPACE USA, INC</b> KENT, WA	
DRAWN	XDF		
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE REPRODUCED OR COPIED OR CHANGED OR TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	




92687

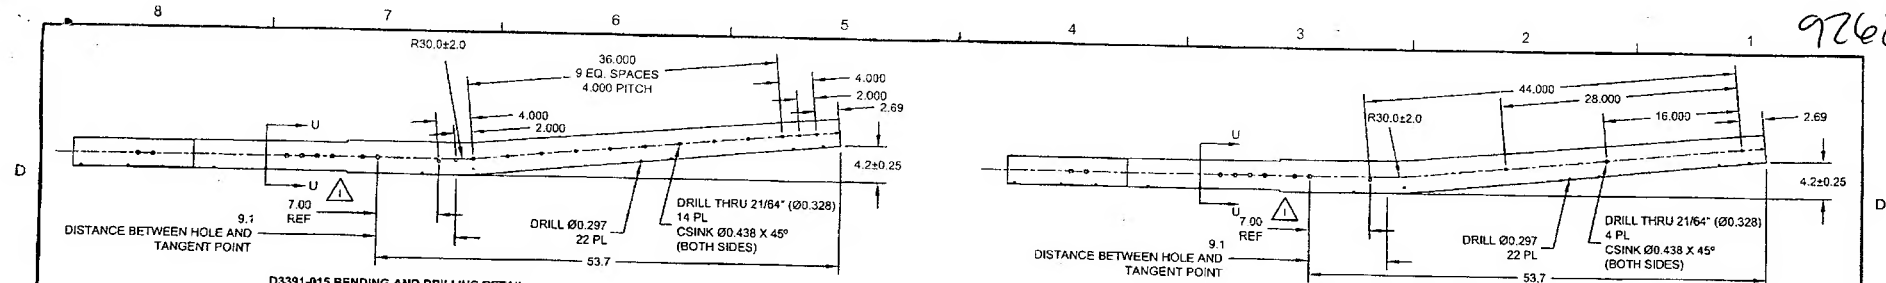


**D3391-015 BENDING AND DRILLING DETAIL**  
(SEE CBORE DETAIL BELOW)

**D3391-025 BENDING AND DRILLING DETAIL**  
(SEE CBORE DETAIL BELOW)

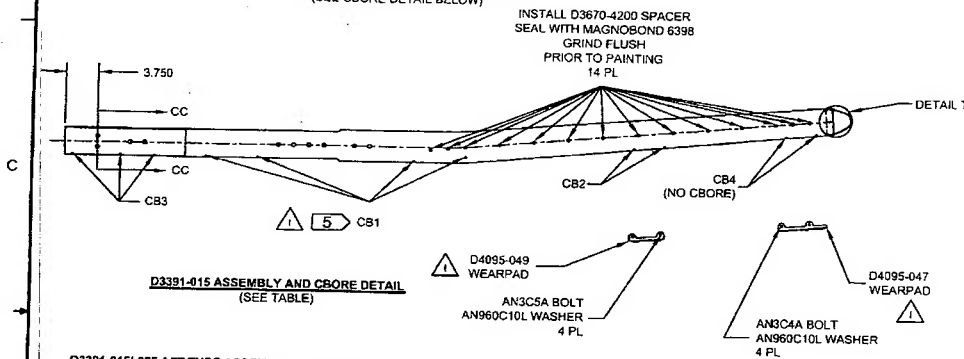


**D3391-015 ASSEMBLY AND CBORE DETAIL**  
(SEE TABLE)

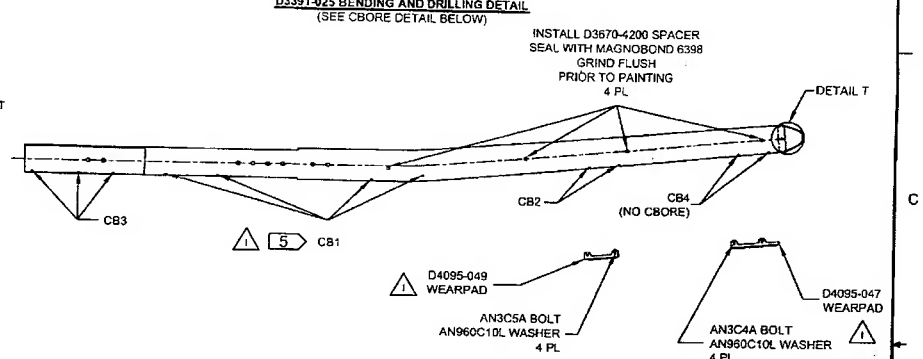


**D3391-025 ASSEMBLY AND CBORE DETAIL**  
(SEE TABLE)

**D3391-015/-025 AFT TUBE ASSEMBLY PARTS LIST**

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
		D3391-025	AFT TUBE ASSEMBLY
1	1	D2646	AFT CAP
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
1	1	D4095-049	WEARPAD
1	1	D4095-047	WEARPAD
1	1	D6014-090	AFT TUBE
14	14	AELS-1032-130	INSERT
8	8	AELS-1032-225	INSERT
4	4	ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

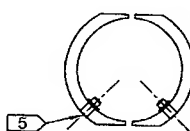


**SECTION U-U**  
SCALE 3X

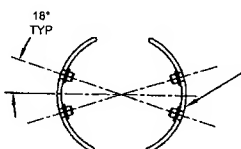

**SECTION CC-CC**  
SCALE 3X

DRILL Ø0.391  
CBORE Ø0.516 X 0.040 DEEP  
INSTALL ALS4-428-165 INSERT  
4 PL

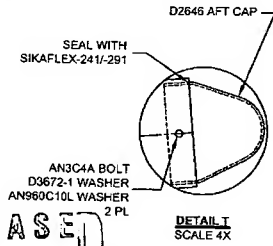

**DETAIL T**  
SCALE 4X

CBORE HOLES MARKED CB1-CB4 AS FOLLOWS AND  
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	CBORE	P/N
CB1	8	8	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

RELEASED  
2011-11-04

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 6 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	



NO. 305

AWS D17.1.2001  
QUALIFICATION TEST RECORD

Name: Barclay Elliott  
Job #: B371870  
Part #: D3391-013  
Description: Skid tube  
Welding Process: Tig[☒] Mig[ ]  
Base material: Aluminium  
Current: AC[☒] DC[ ]

TEST REQUIREMENTS AND RESULTS

Visual:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Incomplete Penetration:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Incomplete Fusion:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Cracks:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Overlap (cold lap)	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Undercut:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Pin holes:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Porosity (surface):	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Coloration:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]
Burn through:	pass[ <input checked="" type="checkbox"/> ]	fail[ ]

Qualifier Pat. Dyl Date of Test Coupon 12-10-01  
Welder Barclay Elliott Date of Test Coupon 12-10-01

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

